

# Rocky Flats Environmental Technology Site

PRO-476-RSP-16.02

**REVISION 1** 

## Pre-Demolition (Final Status) Radiological Surveys of Surfaces and Structures

Responsible K-H Org	Radiation Protect	on	7//	_Effective Date	5/22/01
•		$\Gamma_{i}$	Doctoo		A16101
Approved By Manag			Protection	<del>/-</del>	4/6/01
Title W G Zurljene		)))	Organization		Date
Print Name		W I	Approval Signature  Mahaffey		
Print Na	ne of Responsible		ger (N/A if RM is Ap	proval Authority)	

THE RESPONSIBLE MANAGER HAS DETERMINED THAT THE FOLLOWING ORGANIZATIONS' REVIEW/CONCURRENCE IS REQUIRED REVIEW/CONCURRENCE DOCUMENTATION IS CONTAINED IN THE PROCEDURE HISTORY FILE

KH Analysical Services Division

371/374 Closure Project

KHO&D Advance Planning

707 Closure Project

KH Quality Assurance

771 Closure Project 776/777 Closure Project

KH Radiological Engineering
Material Stewardship and Offsite Shipment Project

Engineering Environmental Safety & Quality Programs

Remediation Industrial Building D&D & Site Services Project

#### IMPORTANT NOTES

ISR Review SISRC 01-13

SES/USQD Review SES-RFP-01 0787 MAW

Periodic Review Frequency 4 years from the effective date

This document supersedes PRO-476-RSP-16 02, Revision 0 and associated forms

REVIEWED FOR CLASSIFICATION/USAN By S. H. Methuemerer S. Classif P Date 05-15-01 applies Approved for Public Release

PADC-1999-02591

21

(05/15/02)

PRO-476-RSP-16 02 REVISION 1 PAGE 2

### LIST OF EFFECTIVE PAGES

Pages	Effective Date	Pages	Effective Date
1	05/22/01	7	23.100kivo Diac
2-3	05/13/02	-	
4	05/22/01	5	
5-6	05/15/02		
7	05/22/01		
<b>8-</b> 13	05/15/02	,	
13A-13B	05/15/02		
14	. <b>05/22/</b> 01	•	-
15-16	05/15/02	, غي	
17	05/22/01	,	
18-21	05/15/02		
22-24	05/22/01	g to the	> <b>1</b>
25	05/15/02	* 3.0	•

Total number of pages: 28

The following changes are active for this procedure.

CHG-16 02-1-2

1

PRO-476-RSP-16 02 REVISION 1 PAGE 3

#### TABLE OF CONTENTS

Section		Page
	TITLE PAGE	1
	LIST OF EFFECTIVE PAGES	2
	TABLE OF CONTENTS	3
1	PURPOSE	4
2	SCOPE	4
3	RESPONSIBILITIES	4
3 1	Radiological Engineer	4
3 2	Radiological Control Technician	4
3 3	RCT Technical Supervision	4
3 4	Procedure User	5
4	REQUIREMENTS	5
4 1	Radiological Survey Requirements	5
42	Use of Background Radiological Surveys	5
5	GLOSSARY	6
5 1	Acronyms	6
52	Definitions	7
6	LIMITATIONS AND PRECAUTIONS	8
7	PREREQUISITE ACTIONS	9
8	INSTRUCTIONS	10
8 1	Survey/Sample Package Documentation	10
82	Surface Scanning Requirements	11
83	Total Surface Activity Survey Requirements	11
8 4	Removable Activity Survey Requirements	12
8 5	Investigation Surveys	13
9	POST-PERFORMANCE ACTIVITY	14
10	RECORDS PROCESSING INSTRUCTIONS	15
11	REFERENCES	15
	ndices	
	ndix 1 Surface Contamination Guidelines (DCGLs)	17
~ ~	ndix 2, Scan and Investigation Methods with Selected Instruments	18
• •	ndix 3 Total Surface Activity Data Sheet	21
	ndix 4, Survey Signature Sheet	22
	ndix 5, Instrument Data Sheet	23
	ndix 6, Removable Activity Data Sheet	24
Appe	ndix 7 Scan Survey/Investigation Documentation Form	25

PRO-476-RSP-16 02 REVISION 1 PAGE 4

#### 1 PURPOSE

This procedure provides guidance for the final status survey of surfaces and structures during decommissioning, to demonstrate that residual radioactive material satisfies unrestricted release criteria.

#### 2 SCOPE

The floors, walls, ceilings, roof, and fixed equipment in the buildings are surveyed. These surveys shall include a Surface Scan, Total Surface Activity Survey, and a Removable Activity Survey.

The forms attached to this procedure are examples that are used in documenting survey/sampling information, however, equivalent forms may be used in lieu of the attached forms (i.e., appendices) as along as the information is equivalent to the minimum information required by the forms in this procedure

This revision supersedes PRO-476-RSP-16 02, Revision 0 and associated forms

#### 3 RESPONSIBILITIES

#### 3 1 Radiological Engineer (RE)

Evaluate the faculity and appropriately classifying survey units

Develop radiological survey packages and instructions for individual survey units

Resolve issues regarding survey unit layout and grid requirements.

Review surveys and sample analysis results for completeness, accuracy, and legibility

#### 3.2 Radiological Control Technician (RCT)

Perform surveys

Provide initial review and sign off of collected data.

Provide complete, accurate and legible documentation.

#### 3.3 RCT Technical Supervision (RCTTS)

Perform the day-to-day supervision of the RCTs.

Review survey forms for accuracy

Take the appropriate actions to mitigate the spread of contamination

#### 34 Procedure User

Read understand and comply with all requirements in this procedure

#### 4 REQUIREMENTS

#### 4 1 Radiological Survey Requirements

- Final Status Survey (FSS) measurements will be conducted in accordance with survey instructions provided in survey packages, which will be developed by Radiological Engineering
- 2 Survey packages will be prepared prior to beginning the FSS
- The measurements will be obtained by conducting surveys using approved methods and techniques such as surface scans surveys, total surface activity surveys removable surface activity surveys, and surface media samples (if required)

#### 42 Use of Background Radiological Surveys

- The Local Area Background (LAB) is the background counts seen by a detector that has a shield placed over the probe A ¼ inch slab of plywood, cardboard, or other thin material is normally sufficient shielding for alpha emitters. A plexiglass shield (or equivalent) may be required for beta-gamma emitters. The detector face may also be turned away from the surface of interest to assess the local area alpha background. If a significant gamma emitter exists, the probe shield material will need to be assessed for use. If material other than plywood is used it should have a nominal density sufficient to shield out any contaminants of concern. Specific shielding technique will be documented in the Survey Package Instructions.
- LAB values should be obtained at each "total surface activity measurement" location just immediately before or after obtaining the actual total surface activity measurement, then recorded on Total Surface Activity Data Sheet (see Appendix 3) or equivalent
  - When measurements are taken on a material proven according to PRO-480-RSP-16 06, Radiological Background Determination to contain naturally occurring radioactive material (NORM) a material background subtraction may be used. If material background subtraction values are not available or a Radiological Engineering evaluation determines that material background values are not necessary, then a conservative material background value of zero may be used.
  - 4 Material background (if applicable) will be determined according to PRO-480-RSP-16 06, Radiological Background Determination

(05/15/02)

PRO-476-RSP-16 02 REVISION 1 PAGE 6

#### 5 GLOSSARY

#### 51 Acronyms

ASD	Analytical Services Division
cpm	Counts Per Minute
D&D	Decontamination and Decommissioning
DCGL <sub>w</sub>	Derived Concentration Guideline Level-Wilcoxon Rank Sum test
$\mathrm{DCGL}_{\mathrm{EMC}}$	Derived Concentration Guideline Level-Elevated Measurement Comparison
DOE	US Department of Energy
dpm	Disintegration Per Minute
DQA	Data Quality Assessment
DQO	Data Quality Objectives
EPA	U.S. Environmental Protection Agency
FDPM	Facility Disposition Program Manual
FSS	Final Status Survey (Analogous to Pre-Demolition Survey)
FSSP	Final Status Survey Plan (Analogous to Pre-Demolition Survey Plan)
FSSR	Final Status Survey Report (Analogous to Pre-Demolitron Survey Report)
HSA	Historical Site Agressment
IPC	In-Process Characterization
LBGR	Lower Bound of the Gray Region
MARSSIM	Multi-Agency Radiation Survey and Site Investigation Manual
MDA	Minimum Detectable Activity
MDC	Minimum Detectable Concentration
NORM	Naturally Occurring Radioactive Material
QA/QC	Quality Assurance/Quality Control
RCT	Radiglogical Control Technician
RCTTS	Radiological Control Technician Technical Supervision
RE	Radiological Engineer
REM	Radiological Engineering Manager
RFETS	Rocky Flats Environmental Technology Site
RLC	Reconnaissance Level Characterization
RLCP	Reconnaissance Level Characterization Plan
RLCR	Reconnaissance Level Characterization Report
RSM	Radiological Safety Manager
TSA	Total Surface Activity
V&V	Verification and Validation

PRO-476-RSP-16 02 REVISION 1 PAGE 7

#### 52 Definitions

Background Radiation - Naturally occurring radiation which may include cosmic terrestrial (radiation from the naturally radioactive elements) and man-made radiation from nuclear fallout

Background Value - A numerical value statistically evaluated and expressed in the appropriate unit of measurement, defining the background radiation

Classification - The act or result of separating areas or survey units into one of three designated classes. Class 1 area an area that is projected to require a Class 1 final status survey, Class 2 area an area that is projected to require a Class 2 final status survey, Class 3 area an area that is projected to require a Class 3 final status survey

Class 1 Survey Unit - Areas that have, or had prior to remediation a potential for radioactive contamination (based on site operating history) or known contamination (based on previous radiological surveys)

Class 2 Survey Unit - An area that has, or had prior to remediation, a potential for radioactive contamination or known contamination, but are not expected to exceed the  $DCGL_w$ 

Class 3 Survey Unit - Any impacted areas that are not expected to contain any residual radioactivity, or are expected to contain levels of radioactivity at a small fraction of the DCGL<sub>w</sub>, based on site operating history and previous radiological surveys

<u>DCGL</u> (<u>Derived Concentration Guideline Level</u>) - A derived, radionuclide-specific activity concentration within a survey unit corresponding to the release criterion

<u>Direct Measurement (Total Surface Activity Measurement)</u> - A radiological survey measurement performed by holding a detector on or close to the media being surveyed

<u>Final Survey</u> - Measurements and sampling to verify the radiological conditions of a site, following completion of decommissioning activities and in preparation for unrestricted release

Impacted Area - Areas that have some potential for containing contaminated material

Non-Impacted Area - Areas where there is no reasonable possibility (extremely low probability) of residual contamination Non-impacted areas are typically located off-site and may be used as background references areas

Removable Activity - Surface activity that can be removed and collected for measurement by wiping the surface with moderate pressure. Also referred to as Removable Contamination, or Smearable Contamination.

Removable Survey - Collecting smears for removable surface activity smears are obtained by wiping an area of approximately 100cm<sup>2</sup>, using a dry filter paper, while applying moderate pressure A 47-mm diameter filter is typically used A smear for removable contamination is typically obtained at each location of direct surface activity measurement (should be taken after the direct surface measurement)

Scan Survey - A qualitative radiological monitoring technique which is performed by moving a detector over the surface at some consistent speed and distance above the surface to detect elevated surface activity

Surfaces and Structures - Site buildings and their surfaces (e.g., floors, walls and ceilings) For purposes of the final survey, external surfaces of fixed equipment are also treated as surfaces and structures.

Survey Package - A collection of information in a standardized format for controlling and documenting field measurements taken for the final survey. A Survey package is prepared for each survey unit/survey area. The survey package includes the survey instructions, grid map(s), survey measurement data sheets and survey maps...

Survey Point - A subset of a measurement location where local measurements are taken, generally referring to an area covered by a detector, or an area of 100 cm<sup>2</sup> when a smear is taken

Total Surface Activity - Surface activity compaising of both removable activity, and fixed activity which cannot be removed by wiping the surface with moderate pressure.

Unrestricted Release - Release of a site from segulatory control without requirements for future radiological restrictions.

#### 6 LIMITATIONS AND PRECAUTIONS

Naturally occurring radioactive material has daughter products (progeny) that
decay by alpha and beta emission and can be falsely interpreted as radioactive
material (e.g., Pu-239, Am-241, U-235, etc.) resulting from DOE operations.

- Generally surveys are performed in the order of surface scan total surface activity survey followed by removable surface activity survey. If the sequence of the total survey and the removable survey gets reversed, (i.e. smears samples are collected prior to total surface activity measurements), the total surface measurement should not be collected at the precise location of the removable surface activity measurement
- Paint, self-adhesive labels, or other marking may shield alpha and beta contamination Apply marking materials sparingly, and do not collect survey measurements directly on the marking
- When final status survey operations are interrupted prior to completion (e.g., due to breaks, shift change, end of workday, etc.), positively identify stopping points to ensure the correct restart location and complete coverage of the required survey

Instrument-specific requirements (scan rate, count time etc.) may differ from those provided in this procedure. For these cases, the requirements delineated in the survey package take precedence over this procedure

#### 7 PREREQUISITE ACTIONS

#### **Procedure User**

- [1] Ensure that the following activities are performed prior to surveying
  - Decommissioning activities, (i e, strip-out and removal) with the potential to contaminate the survey unit subsequent to final status survey are complete
  - Isolation Controls are in place
  - Survey personnel have been trained in the use of instrumentation and survey procedures prior to the collection of final survey data
  - The survey package has been approved for implementation, including survey instructions regarding the location, number, and types of survey measurements required
  - Review the area/activity-specific job hazard analysis (JHA) to identify and obtain any tools personnel protective equipment (PPE) or equipment require to control the anticipated hazards

(05/15/92)

#### 8 INSTRUCTIONS

Sections 8.2 through 8.5 are stand-alone sections and may be performed independently in conjunction with Section 8.1

#### 81 - Survey/Sample Package Documentation

#### **RCT**

[1] Maintain survey records in the survey package

The survey package will be the primary method of controlling and tracking radiological survey results.

NOTE DO NOT use shorthand, non-standardized terms, or opaque substances for corrections.

- [2] Document surveys accurately and legibly in thick with sufficient detail to ensure that the meaning and intent of the record is clear
  - [A] Make corrections as follow-
    - [a] Draw a single line through the incorrect entry.
    - [b] Record the correct entry
    - [c] Date and initial the correction
- [3] Enter sufficient detail to ensure that the identification of the original survey and the sample location(s) is maintained and clear.

NOTE When values are less than the inhimum Detectable Concentration (MDC), the actual value is annotated on the survey form.

[4] Record each specific value for the instrument used.

Data is entered for each and every survey point unless written direction is provided by RE

- [5] Record the Local Area Background (LAB) when obtained.
- [6] If required, record the material type for each measurement
- [7] Record applicable information on the survey form (s), in addition to the radiological data.
- [8] Record all required instrument information on the appropriate survey forms.

- [9] Record any pertinent information needed to interpret the survey results
- [10] Record name signature and employee number of individual(s) performing the survey on the Survey Signature Sheet (see Appendix 4)
- [11] Once all survey results have been recorded, maintain all survey forms in survey package
- [12] Submit the completed survey package to the RCTTS for review

#### 82 Surface Scanning Requirements

#### **RCT**

- NOTE Scan survey coverage can vary from biased (judgmental) to 100 percent of the accessible surface area
- [1] Perform a scan survey for total surface activity per the requirements in the survey package
- NOTE

  The scan minimum detectable concentration (MDC) must be equal to or less than the Derived Concentration Guideline Level Elevated Measurement Comparison (DCLGEMC) or applicable action level (refer to survey package)
- [2] Utilize the flowcharts locations (refer to Appendix 2, page1) provided to flag and investigate elevated measurements
  - Flowcharts should be developed for other instrumentation that is utilized for the survey Requirements (flag levels, etc.) for the flowcharts are based on the guidance provided in the survey package
- [3] Complete and sign Survey Signature Sheet (see Appendix 4)

#### 8 3 Total Surface Activity Survey Requirements

NOTE Total Surface Activity Measurements are typically collected prior to the collection of removable activity and media samples If not practical collect the measurement immediately adjacent to the removable activity/sample location

#### **RCT**

- [1] Obtain the approved survey package, amplifying instructions, survey maps flowcharts, and other necessary information (such as applicable safety requirements) to perform surveys
- [2] Select Alpha/Beta NE Electra w/ DP 6 Probe, or equivalent instrument for total activity measurements
  - [A] Perform a pre-operational inspection and record all pre-operational check data on appropriate form

SURFACES AND STRUCTURES

(05/15/02)

- Record instrument information on lastrument Data Sheet (see Appendix BI
- IF NOT already completed, [3] THEN transpose survey numbers from attached survey maps onto labels at each corresponding measurement location on the survey unit surfaces
- CHG 16 02 1 2 Obtain a total surface activity (direct) measurement and record actual numeric [4] results as gross counts per minute (genera) on Total Survey Activity Data Sheet (see Appendix 3), refer to survey package for count time.
  - Obtain at each survey point a LAB (oppn), refer to Section 4.2, and record on [5] Total Survey Activity Data Sheet (refer to survey package for count tune)
  - Collect QC measurements (number to be specified in survey package) over the [6] range of positive values (i.e., results greater than zero) in accordance with PRO-479-RSP-16 05, Radiological Survey/Sample Quality Control for Final Status Survey
  - Record results on Total Survey Activity Data Sheet. [7]
  - NOTE 1 The mean LAB count is subtracted from the location-specific gross count after each is converted to dpm by dividing by the instrument efficiency
  - NOTE 2 A post-survey performance check is required in accordance with Site Radiological Control Manual Chapter 3 Fort 5 Data is suspect unless performance check passes as per PRO-479-RSP-16 05
  - Complete and sign Survey Signature Sheet (see Appendix 4) [8]
  - 84 Removable Activity Survey Requires
    - NOTE 1 Swipes are typically collected following the performance of total surface activity measurements and prior to the collection of media samples
    - NOTE 2 Swipe technique for removable surface activity are typically obtained by wiping an area of approximately 100 cm2, using a dry filter paper, while applying moderate pressure A 47-min diameter filter is typically used A swipe for removable contamination is obtained at each total activity measurement location.

RCT

Obtain a 100 cm² removable swipe at each labeled sample location (surface area [1] smeared may vary if annotated in the survey package),

- [2] Place swipes into envelope or other containers to prevent cross-contamination while awaiting analysis
- [3] Analyze swipes using an approved Tennelec instrument or equivalent
  - [A] IF analyzed manually (i e, SAC-4, BC-4 L-2929/43-10-1),
    THEN record the required instrument data on Instrument Data Sheet (see
    Appendix 5) and survey results on Removable Activity Data Sheet (see
    Appendix 6)
  - NOTE Computer generated forms contain all the same information as Appendix 6
  - [B] IF analyzed by a Tennelec,
    THEN attach computer-generated reports to the survey package
- [4] Complete and sign Survey Signature Sheet (see Appendix 4)
- [5] Forward the survey package to the RCT Technical Supervisor for review

#### 85 Investigation Surveys

NOTE Survey package instructions and the flowcharts (refer to Appendix 2 page 2) provide guidance and direction in the performance of Investigation Surveys

#### **RCT**

- [1] Verify the elevated measurement by taking a second TSA measurement in the exact same location and record results on the Scan Survey/Investigation

  Documentation Form (Appendix 7) and the instrument information on the Instrument Data Sheet (Appendix 5) If the second TSA measurement is less than 100 dpm/100 cm², the investigation is complete Record the second TSA measurement on the Survey Package Scan and Investigation form
- [2] Select one or both of the following investigation methods
  - [A] Determine if the elevated reading(s) is/are due to DOF added material
  - NOTE Po<sup>210</sup> a radon daughter product may accumulate on oxidized metal surfaces and/or where rainwater accumulates and evaporates
    - 1) The location(s) in question should be sealed and allowed to decay and then remeasured for TSA Radiological Engineering is contacted for specific instructions

NOTE In areas where short-lived natural radioactivity is suspected the surveyed surface may be realed from atmosphere using airtight tape and/or plastic to allow for short-lived thicope decay. Material or property believed to be free of contamination may be unsealed and recounted a minimum of twenty (26) immutes after the initial count to allow for decay of short-lived radionactides. A decrease in alpha activity over 20 minutes, accompanied by beta activity indicates the presence of the short-lived naturally occurring radionactides. Recounting two to four hours after the initial count allows for a majority of naturally occurring radioactive material to decay. Recounting after additional hours of decay may result in further decreases in observed activity.

- 2) Isotopic analysis such as apectroscopy or wet chemistry may be needed to distinguish between algain activity from radioactive material (e.g., Pu<sup>235</sup>, Am<sup>241</sup>, U<sup>235</sup>, etc.) resulting from DOE operations and Naturally Occurring Radioactive Material (NORM). Radiological Engineering is contacted for specific instructions.
- [B] Perform a nine-point average by collecting 8 additional measurements from an area approximately 1 m<sup>2</sup> centered around the original elevated measurement for a total of 9 measurements in three rows of three measurements each

CHG-16 02 1-2

This page is left intentionally blank

#### 9 POST-PFRFORMANCE ACTIVITY

NOTE Documentation generated as result of this procedure is retained and dispositioned per Section 10 Records Processing Instructions

#### **RCT Technical Supervisor**

- [1] Review survey package to ensure that survey(s) has been completed as required and documentation is accurate and complete
- [2] Return unacceptable survey package(s) to the RCT performing/documenting the survey for correction
- [3] Ensure the RCT promptly corrects errors and omissions and resubmits the survey results.
- [4] WHEN it is not possible for the originator to correct an error,
  THEN explain on the applicable form, why originator could not make
  corrections
  - [A] Enter the correction
  - [B] Initial and date the correction.
- [5] Not all lines or blanks will be pertinent for all surveys performed

Each blank must have an entry in it so that an improper entry may not be entered later. This can be accomplished by a line out of a section with a continuous single line, initialing and dating the line or use the lettering "NA" or "N/A" to indicate "not applicable."

- [6] Sign Survey Signature Sheet (see Appendix 4) denoting all required surveys/samples have been completed.
- [7] Forward the survey package to the Radiological Engineer for data analysis and final disposition

#### 10 RECORDS PROCESSING INSTRUCTIONS

The following documents are handled or initiated during performance of the activities described in this procedure

	Record Identification	Record Type	Protection/Storage	Processing Instructions
CHG 16 02 1 2 CHG 16 02 1 2	In process Appendix 3 Total Surface Activity Data Sheet or equivalent Appendix 4 Survey Signature Sheet or equivalent Appendix 5 Instrument Data Sheet, or equivalent Appendix 6, Removable Activity Data Sheet, or equivalent Appendix 7, Scan Survey/Investigation Documentation Form, or equivalent and other documentation as identified in the procedure that make-up the Survey Package	In process QA Record (Non WIPP)	Responsible Manager implements a reasonable level of protection for inprocess QA records to prevent loss or degradation Records are stored in standard office filing systems	Continued prescribed processing of documents Upon completion of processing, approval and authentication records are transmitted to appropriate Records Center (e g, Project Records) in accordance with 1-V41-RM-001 Records Management Manual
CHG 16 02 1 2	Completed Same as forms as identified above	Completed QA Record (Non-WIPP)	Responsible Manager implements a reasonable level of protection for QA records to prevent loss or degradation in conjunction with Site Records Management organization to assure reasonable level of controls are being implemented	When inactive as defined in 1-V41-RM-001, Records Management Manual transfer to Site Records Management for archiving in accordance with 1-V41-RM-001

#### 11 REFERENCES

The following documents are either directly referenced or used in the development of this procedure

DOE Order 5400 5 - Radiation Protection of the Public and the Environment

MAN-102-SRCM Rocky Flats Environment Technology Site Radiological Control Manual

MAN-127-PDSP, Pre-Demolition Survey Plan (also referred to as Site PDSP)

PRO-479-RSP-16-05, Radiological Survey/Sample Quality Control for Final Status Survey

PRO-480-RSP-16 06, Radiological Background Determination

RF/RMRS-97-123 UN, Radiological Closeout Survey Plan for the 779 Cluster

TBD-00153, Use of the Oasis for Direct Differentiation between Po-210 and DOE-added materials

TBD-00156, Using Graphical Data Distribution Analysis to Distinguish between background and DOE-added Materials in Environmental Data Sets:

Title 10 Code of Federal Regulations Part 835, Occupational Radiation Protection

1-V41-RM-001, Records Management Manual

3-PRO-165-RSP-07 02, Contamination Monitoring Requirements

CHG 1602 12

(05/22/01)

PRO-476-RSP-16 02 REVISION 1 PAGE 17

## APPENDIX 1 Page 1 of 1


#### SURFACE CONTAMINATION GUIDELINES (DCGLs)

Radionuclides <u>2/</u>	DCGLW Total Average 3/4/ (dpm/100 cm <sup>2</sup> )	DCGL <sub>EMC</sub> Total Maximum 4/5/ (dpm/100 cm <sup>2</sup> )	DCGLW Removable 4/6/ (dpm/100 cm <sup>2</sup> )
Transuranics, I 125 I 129 Ra 226 Ac 227 Ra 228 Th 228 Th 230 Pa 231	100	300	20
Th Natural Sr 90 1 126 1 131 Ra 223 Ra 224 U 232 Th 232	1 000	3 000	200
U-Natural U 235 U 238 and associated decay products, alpha emitters	5 000	15 000	1 000
Beta-gamma emitters (radionuclides with decay modes other than alpha emission or spontaneous fission) except Sr 90 and others noted above 7/	5 000	15 000	1 000
Tritium (applicable to surface and Subsurface) 8/	Not Applicable	Not Applicable	10 000


- 1/ As used in this table dpm (disintegration per minute) means the rate of emission by radioactive material as determined by correcting the counts per minute measured by an appropriate detector for background efficiency and geometric factors associated with the instrumentation
- 2/ Where surface contamination by both alpha and beta gamma emitting radionuclides exists, the limits established for alpha and beta gamma radionuclides should apply independently
- 3/ Measurements of average contamination should not be averaged over an area of more than 1 m<sup>2</sup> For objects of less surface area, the average should be derived for each such object
- 4/ The average and maximum dose rates associated with surface contamination, resulting from beta-gamma emitters should not exceed 0.2 mrad/h and 1.0 mrad/h respectively at 1 cm
- 5/ The maximum contamination level applies to an area of not more than 100 cm<sup>2</sup> DOE 5400 5 Chg 2 IV 7
- 6/ The amount of removable material per 100 cm<sup>2</sup> of surface area should be determined by wiping an area of that size with dry filter or soft absorbent paper applying moderate pressure, and measuring the amount of radioactive material on the wiping with an appropriate instrument of known efficiency. When removable contamination on objects of surface area less than 100 cm<sup>2</sup> is determined, the activity per unit area should be based on the actual area and the entire surface should be wiped. It is not necessary to use wiping techniques to measure removable contamination levels if direct scan surveys indicate that the total residual surface contamination levels are within the limits for removable contamination.
- 7/ This category of radionuclides includes mixed fission products including the Sr 90 which is present in them. It does not apply to Sr 90 which has been separated from the other fission products or mixtures where the Sr 90 has been enriched
- 8/ Property recently exposed or decontaminated should have measurements (swipes) at regular time intervals to ensure that there is not a build up of contamination over time. Because tritium typically penetrates material it contacts the surface guidelines for beta gamma emitters are not applicable to tritium. The DOE has reviewed the analysis conducted by the DOE Tritium Surface. Contamination Limit Committee (Recommended Tritium Surface Contamination Release Guides, February 1991), and has assessed potential doses associated with the release of property containing residual tritium. The DOE recommends the use of the stated guideline as an interim value for removable tritium. Measurements demonstrating compliance of the removable fraction of tritium on surfaces with this guideline are acceptable to ensure that non removable fractions and residual tritium in mass will not cause exposures that exceed DOE dose limits and constraints.

APPENDIX 2
Page 1 of 3

## SCAN AND INVESTIGATION METHODS WITH SELECTED INSTRUMENTS

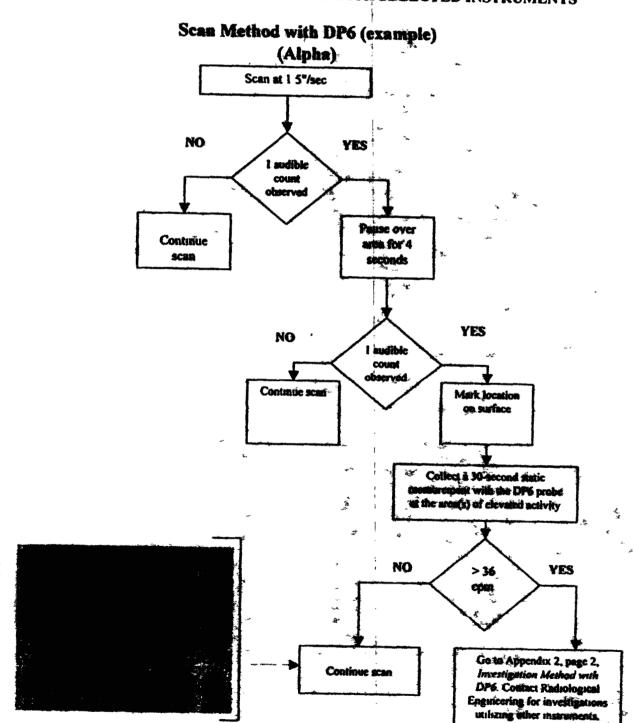


## Page 2 of 3

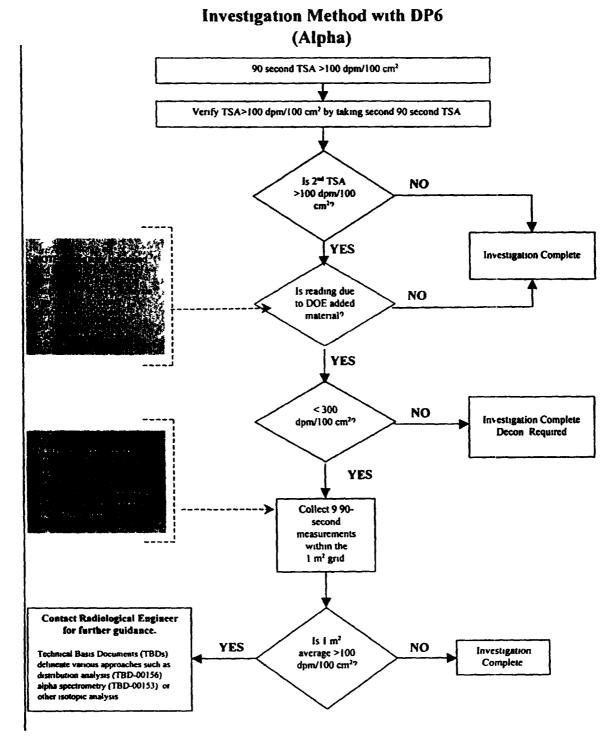

### **APPENDIX 2**

Page 3 of 3

## Alpha Scan Method with DP8A or equivalent Revision 1

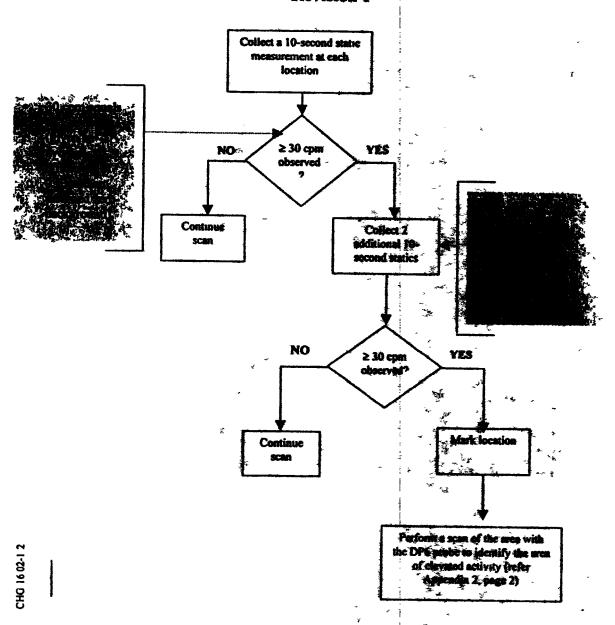

APPENDIX 3
Page 1 of 1

#### TOTAL SURFACE ACTIVITY DATA SHEET

Survey Area		Surv	ey Unit			Building			
Survey Area	a/Unit Description								
					y Data Sh	eet			
				☐ Beta		1 0-	et Total	Surface Ac	*****
Sample	Material Type	1		Surface Act	ivny	Po		Surface Ac surements	uvny
Location	(If Req d)	RCT	Inst	LAB	Gross	RCT	Inst	LAB	Gross
]		ID#	1D#	(cpm)	(cpm)	ID#	ID#	(cpm)	(cpm)
1				T					
2		1							
3									
4									
5									
6	<del> </del>	1		1					
7						A			
8							2		
9		1	7	1	111	11-1	1	1	
10	•		<del></del>	-111		<i>-</i>	<del>                                     </del>		1
11		T - 1	/·	71-11		1-1	T - [		
12		<del>                                     </del>		71-1	17	1			
13			7 <b>/</b> /	$+\Gamma\Gamma$	TH	<del>                                     </del>	Ь- 	<del>                                     </del>	
14					-				
15		1	1				1		
16			<del>                                     </del>			1	<del>                                     </del>		1
17		1	1			1	1	1	1
18		1	1		<b> </b>	1	<del>                                     </del>		1
19		1		<del>- </del>	<del>                                     </del>	<del>                                     </del>	<del> </del>	<del> </del>	<del>                                     </del>
20		1	1	1	<del> </del>	1	<del>                                     </del>	1	1
QC		<del> </del>	<del>                                     </del>	<del> </del>	<del>                                     </del>	<del>                                     </del>	<del>                                     </del>	†	1
QC		1	1	1	<del> </del>	1	<del>                                     </del>	+	<del>                                      </del>
Commen	ts				<u> </u>			<u> </u>	
~~									
OUNT TI	ME = (sec)			<del></del>					

Note QC measurements are to be collected with a different instrument than the original survey. Mark the QC location number in the "Sample Location column

23

PRO-476-RSP-16 02 REVISION 1 PAGE 22

## APPENDIX 4 Page 1 of 1

#### SURVEY SIGNATURE SHEET

Survey Area	Su	rvey Unit:		Building.	
Survey Area/	/Unit Description		4	1	
	0.120			2	
<u> </u>		VEY SIGN. urface Activ		SHEET Surveys Performed B	<b>y</b>
RCT ID#1					ý
ID#1	"RCT Printed Name	Emplo	vaic #	RET Signature	Date
RCT			3		
ID#2					<u> </u>
RCT	RCT Printed Name	Emplo	yes#-	RCT Signature	Date
ID#3			<b>†</b>	· ·	4 ~
	RCT Printed Name	Emplo	yee #	RCT Signature	Date
RCT		-		; * :	
ID#4			1		
RCT	RCT I Inter Nan	Empl	上十	- Se bann -	Date
ID#5	). بست		1 / 1		F
	RCT I inted Nar		et I	RC Signati	Date
RCT					
ID#6	collection and a second				
	RCT Printed Name	Employ	ree # 1	RCT Signature	Date
	Quality Cor	ntrol Measu	rements	Performed By	
RCT					
ID#7	- 0m h 2	<del></del>			<del></del>
RCT	RCT Printed Name	Employ	/00#	RCT Signature	Date
ID#8			1	* **	
	RCT Printed Name	- Employ	/ce#	RCT Signature	Date
RCT				* .	
ID#9	~ ~ ~			3	
RCT	RCT Printed Name	Employ	/60 R	RCT Signature	Date
ID# 10	*	1	1	J ~ .	1
	RCT Printed Name	Employ	ree #	RCT Signature	Date
nt.			~ %	1	
		Survey Re	viewed B		
				1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1	
RCT Supervision	on Printed Name   Empl	loyee#	RCT Supe	ryhion Signature	Date

PRO-476-RSP-16 02 REVISION 1 PAGE 23

### APPENDIX 5

#### Page 1 of 1

#### INSTRUMENT DATA SHEET

Survey Area		Survey Unit	<u> </u>	Build	ling	
Survev Area/Unit De	scription					
		INSTRUM	ENT DATA S	HEET	·····	
 	Reme	ovable Activi	ty Survey Inst	rument Data	·	
Manufacturer						ļ
Model					<u> </u>	
Inst ID#	1	2	3	4	5	6
Serial #					<u> </u>	
Cal Due Date						
Analysis Date		<u> </u>			لے	
Alpha Bkgd (cpm)						
Alpha Eff (c/d)		<u> </u>			لــــــــــــــــــــــــــــــــــــــ	
Instrument a MDC		/ \				T
(dpm'100 cm <sup>2</sup> )	<u>_                               </u>	┸┸┸┸	<b>└</b> - <b>└</b> - <b>└</b> - <b>└</b> -	 	 	
Beta Bkgd (cpm)						
Beta Eff (c/d)						
Instrument β MDA (dpm/100 cm <sup>2</sup> )						
	То	tal Surface A	ctivity Instru	ment Data		
Manufacturer						<u> </u>
Model						
Inst ID#	7	8	9	10	11	12
Serial #						
Cal Due Date						
Analysis Date						
Alpha Bkgd (cpm)						
Alpha Eff (c/d)						
Instrument a MDC						
(dpm/100 cm <sup>2</sup> )						
Beta Bkgd (cpm)						
Beta Eff (c/d)						
Instrument β MDA (dpm/100 cm <sup>2</sup> )						

_	_
Page	of

(05/22/01)

PRO-476-RSP-16 02 REVISION 1 PAGE 24

## APPENDIX 6 Page 1 of 1

#### REMOVABLE ACTIVITY DATA SHEET

ocation #	RCT ID#	Remova	ble Activity Date		Building	
#	RCT ID#		ble Activity Date	Chair	<del></del>	······································
#	RCT ID#			Ducet		
1	-	In	et ID#	72	·Gress co	unts-
	1	α	β	1	<b>α</b> ,	β
2				. P	·	*
3				Gen ;		
4			, , , ,			
5				<del>-</del>	<del></del>	
7		<del> </del>	+	-	n .	
8		<u> </u>	<del></del>	-	<del></del>	
9		f \ #	+	1		*
10			此一十二			
11				TI		
12				Æ		
13			ICULE	IL		
14			111111			
15					14.	*
16 17.		<del></del>	<del> </del>	1-+	<del></del>	<del></del>
18			+	+		
19		<del></del>	+	*		
20	<del></del>			1		>-9
21			1		Ť	
22				1		
23						*
24			<u> </u>	4		<del></del>
25			نج	<u> </u>		
omments.		~	2/20°	ĺ	*	•
				:		
				٠ -		
					4	
				1-2 1-2		
			Žei	20 v. 20 .	:	*
i			٤	* <del>*</del> *.	. ←	
						<b>~</b>
	T TIME =(				3.7	

26

PRO 476-RSP-16 02 REVISION I PAGF 25

APPENDIX 7
Page 1 of 1

#### SCAN SURVEY/INVESTIGATION DOCUMENTATION FORM

		y Area/U	Jnit Des	cription	Survey Un	<u>it</u>	<del></del>	Bui	lding		
	SCAN SURVEY/INVESTIGATION DOCUMENTATION FORM										
	-		NE I	Electra Beta				NE E	lectra Alp	ha .	<del></del>
	Loc ID#	RCT ID#	inst ID#	Elevated Audible observed? "Y or "N"	90-sec Direct (dpm/100 cm <sup>2</sup> )	RCT ID#	inst ID#	4 sec Audible observed? "Y or "N"	30-sec Static (gcpm)	90-sec (cpm/100 cm <sup>2</sup> )	Direct (dpm/100 cm <sup>2</sup> )
							-   -				
						11					
	NOTI	Refer	to the In	strument Data	Sheet and S	urvey Su	pnature	Sheet for inst	nimentatio	on surveyor d	& approval
	ınforn						<b>9</b>				
	Resul	ts/Comm	ients								

27/17

Page\_\_\_of\_\_